



Sports Car Service  
2188 Stephens Dr  
Tucker, GA 30084

(404)435-6760  
sportscarservice@gmail.com

P2774

FINAL

## Estimate

Date	Estimate #
12/22/2015	1075

### Address

Merlin Auto Group  
2882 Amwiler Rd  
Atlanta, GA 30360  
ZFFXA20A2G0063077  
1986 328Gts Miles 36074/

Service	Activity	Quantity	Rate	Amount
	<b>12/21/2015</b>			
General vehicle Inspection	• General Vehicle Inspection, correct intake leak & diagnose rough running, adjust fuel mixture, set idle speed. road test.	1	350.00	350.00
Recommendations	• Additional recommended repairs noted during inspection/require routine inspection by the owner or qualified repair shop for safe operation. Replace Cam belts & bearings, Cam cover gskts, Cold enrichment switch, Intake boot, Change coolant & reservoir cap, Oil & filter service, Change gear oil, Flush brake system, Replace leaking Shift rod seals, R&R AC receiver drier & Convert to 134A, repair Wiper switch, one heater blower motor noise, center dash vent broken, left htr control inoperative. Vehicle has slight vibration in steering and pulls slightly left	1	0.00	0.00
	<b>Subtotal: 12/21/2015 = \$350.00</b>			
	<b>12/22/2015</b>			
5yr Belt Service 308/328	• 5yr belt service 308/328 R&R timing belts, Tensioner bearings, accessory belts. Inspect Hydraulic Belt Tensioners, driver*s controls, lights, battery, brakes, and tires.	1	1,050.00	1,050.00
111334D Cam belt 308/328	• Cam Belts 4 valve	2	24.95	49.90
105206 Cam belt bear 308/328	• Cam belt tensioner bearing's	2	74.76	149.52
121655 Water pump belt 308/328	• Water pump belt 308/328	1	25.15	25.15
105046 Ac belt 308/328	• Ac belt 308/328	1	38.50	38.50
130493 Alt belt 308/328	• Alternator belt 308/328/TR	1	18.98	18.98
Antifreeze	• Antifreeze/coolant	2	14.35	28.70
	Continue to the next page			

Service	Activity	Quantity	Rate	Amount
Distilled Water	• Distilled Water	2	1.35	2.70
Clamps	• Clamps smooth surface	4	1.15	4.60
101499 0.9 bar coolant cap	• Coolant cap 0.9bar	1	28.60	28.60
121777 Cold enrichment switch 308/328	• Cold enrichment switch 308/328	1	157.50	157.50
114019 308/328 intake boot	• 308/328 intake air cleaner boot	1	121.90	121.90
<b>Subtotal: 12/22/2015 = \$1,676.05</b>				
<b>12/30/2015</b>				
Labor charges	• Labor charges Change oil & filter, flush brakes, power wash engine and gearbox	4.5	105.00	472.50
191993 oil filter 308/328	• Oil filter 308/328	1	49.85	49.85
Valvoline 10/w50 racing oil	• 10w50 Valvoline racing engine oil	10	9.98	99.80
Brake Fluid	• Dot 4 Brake Fluid	1	14.45	14.45
Sealing washers	• Sealing washer	2	1.05	2.10
Brake cleaner	• Brake cleaner/Carb cleaner	1	5.95	5.95
<b>Subtotal: 12/30/2015 = \$644.65</b>				
<b>01/04/2016</b>				
Coolant hose 1-5/8	• Bulk coolant hose 1-5/8	1	12.34	12.34
117351U 5/8 Cam belt cover used	• 5/8 Cam belt cover used (original cam belt cover was cracked at one mounting point)	1	250.00	250.00
<b>Subtotal: 01/04/2016 = \$262.34</b>				
<b>01/06/2016</b>				
Labor charges	• Labor charges Replace fuel hose between tank and fuel pump	1	105.00	105.00
Fuel hose	• Fuel hose 16mm between tank and pump	3	7.78	23.34
<b>Subtotal: 01/06/2016 = \$128.34</b>				
			<b>Total</b>	<b>\$3,061.38</b>

Accepted By

Accepted Date

# MERLIN AUTO GROUP

## Merlin Auto Group

2882 Amwiler Rd  
Atlanta GA 30360  
(B)(770) 457-2699

Invoice Date: 9/1/2017 6:49 PM

Technician: Carl (5)

Customer Information	Vehicle Information
Merlin Auto Group 2882 Amwiler Rd Atlanta GA 30360 (B) (770)457-2699	1986 Ferrari 328 GTS 3.2L V8 DOHC 32V VIN: ZFFXA20A2G0063077 License: Vehicle #P2776 Mileage (mi) 36,245 / 36,255

Operation/Part	Description	Quantity	Part	Labor	Other	Amount
INSP	INSPECTION FORM: COMPLETE PHASE 3 COMPLETED PHASE 3 INSPECTION AND TEST DROVE.	1.000	0.00	0.00	0.00	0.00
	<b>Inspection Subtotal:</b>		<b>0.00</b>	<b>0.00</b>	<b>0.00</b>	<b>0.00</b>
AC-L2	AIR ONLY BLOWING ON LEFT SIDE OF CAR SUBLET TO FERRARI OF ATLANTA: AC RECHARGE COMPLETED.	1.000	0.00	0.00	461.10	461.10
	<b>Climate Control (HVAC) Subtotal:</b>		<b>0.00</b>	<b>0.00</b>	<b>461.10</b>	<b>461.10</b>
INTA-L	TRUNK RELEASE TRIM BROKEN REPLACED TRUNK RELEASE TRIM	1.000	0.00	0.00	0.00	0.00
63011800R	HOOD/TRUNK HANDLE RELEASE	1.000	219.99	0.00	0.00	219.99
61808300B	HEATER CONTROL SWITCH	1.000	512.71	0.00	0.00	512.71
	<b>Interior Subtotal:</b>		<b>732.70</b>	<b>0.00</b>	<b>0.00</b>	<b>732.70</b>
150075	GASKET END COVER	1.000	27.18	0.00	0.00	27.18
150078	V/C GASKET QV	1.000	31.59	0.00	0.00	31.59
147676	ENGINE OIL PAN GASKET	1.000	16.94	0.00	0.00	16.94
EI-L	ROUGH IDLE ON COLD START STARTED VEHICLE WHEN COLD AND FELT A SLIGHT ROUGH IDLE FOR ABOUT 2 SECONDS THEN RAN AS DESIGNED. STARTED MULTIPLE TIMES AFTER AND ENGINE STARTED AS DESIGNED.	1.000	0.00	0.00	0.00	0.00
	<b>Engine Subtotal:</b>		<b>75.71</b>	<b>0.00</b>	<b>0.00</b>	<b>75.71</b>
50108703	5 PRONG RELAY	2.000	22.03	0.00	0.00	44.06
	<b>Electrical Subtotal:</b>		<b>44.06</b>	<b>0.00</b>	<b>0.00</b>	<b>44.06</b>

Parts	852.47
Labor	0.00
<b>Subtotal</b>	<b>852.47</b>
Other Charges	461.10
<b>Total Due</b>	<b>1,313.57</b>

Payment:

Thank You for choosing Merlin Auto Group!

# MERLIN AUTO GROUP

## Merlin Auto Group

2882 Amwiler Rd  
Atlanta GA 30360  
(B)(770) 457-2699

Invoice Date: 11/6/2017 1:48 PM

Technician: Roger (8)

Customer Information	
Merlin Auto Group	
2882 Amwiler Rd	(B) (770)457-2699
Atlanta GA	
30360	

Vehicle Information	
1986 Ferrari 328 GTS 3.2L V8 DOHC 32V	
VIN: ZFFXA20A2G0063077	
License:	Mileage (mi) 36,319 / 36,397
Vehicle #P2776	

Operation/Part	Description	Quantity	Part	Labor	Other	Amount
EE-L	TEST DRIVE FOR GENERAL INSPECTION PERFORMED INSPECTION AND TEST DRIVE	1.000	0.00	0.00	0.00	0.00
	<b>Engine Subtotal:</b>		<b>0.00</b>	<b>0.00</b>	<b>0.00</b>	<b>0.00</b>
ELEC-L	HORN NOT WORKING LUBED COMPRESSOR TO CORRECT/HORN WORKING AS DESIGNED	1.000	0.00	0.00	0.00	0.00
	<b>Electrical Subtotal:</b>		<b>0.00</b>	<b>0.00</b>	<b>0.00</b>	<b>0.00</b>
TUNE-L	PERFORM TUNE UP/REPLACED SPARK PLUGS/REPLACE DISTRIBUTOR ROTOR VEHICLE HAD A ROUGH IDLE. REMOVED AND REPLACED 8 SPARK PLUGS, 2 DISTRIBUTOR ROTORS AND 1 FUEL FILTER. CLEANED THE DISTRIBUTOR CAP NEEDLES AND CONTACTS. ADDED ONE FUEL TREATMENT TO THE GAS.	1.000	0.00	0.00	0.00	0.00
	<b>Tune Up / Scheduled Maintenance Subtotal:</b>		<b>0.00</b>	<b>0.00</b>	<b>0.00</b>	<b>0.00</b>
130965	SPARK PLUG	8.000	13.00	0.00	0.00	104.00
126139R	IGNITION ROTOR	2.000	70.00	0.00	0.00	140.00
	<b>Ignition System Subtotal:</b>		<b>244.00</b>	<b>0.00</b>	<b>0.00</b>	<b>244.00</b>
117792	FUEL FILTER \$11.04 FOR SHIPPING.	1.000	25.00	0.00	11.04	36.04
	<b>Fuel System Subtotal:</b>		<b>25.00</b>	<b>0.00</b>	<b>11.04</b>	<b>36.04</b>

Parts	269.00
Labor	0.00
<b>Subtotal</b>	<b>269.00</b>
Other Charges	11.04
<b>Total Due</b>	<b>280.04</b>

**Payment:**

Other (280.04)

Thank You for choosing Merlin Auto Group!

# MERLIN AUTO GROUP

**Merlin Auto Group**  
2882 Amwiler Rd  
Atlanta GA 30360  
(B)(770) 457-2699

Invoice Date: 11/6/2017 1:48 PM

Technician: Roger (8)

Customer Information	
Merlin Auto Group	
2882 Amwiler Rd	(B) (770)457-2699
Atlanta GA	
30360	

Vehicle Information	
1986 Ferrari 328 GTS 3.2L V8 DOHC 32V	
VIN: ZFFXA20A2G0063077	
License:	Mileage (mi) 36,319 / 36,397
Vehicle #P2776	

Operation/Part	Description	Quantity	Part	Labor	Other	Amount
EE-L	TEST DRIVE FOR GENERAL INSPECTION PERFORMED INSPECTION AND TEST DRIVE	1.000	0.00	0.00	0.00	0.00
	<b>Engine Subtotal:</b>		<b>0.00</b>	<b>0.00</b>	<b>0.00</b>	<b>0.00</b>
ELEC-L	HORN NOT WORKING LUBED COMPRESSOR TO CORRECT/HORN WORKING AS DESIGNED	1.000	0.00	0.00	0.00	0.00
	<b>Electrical Subtotal:</b>		<b>0.00</b>	<b>0.00</b>	<b>0.00</b>	<b>0.00</b>
TUNE-L	PERFORM TUNE UP/REPLACED SPARK PLUGS/REPLACE DISTRIBUTOR ROTOR VEHICLE HAD A ROUGH IDLE. REMOVED AND REPLACED 8 SPARK PLUGS, 2 DISTRIBUTOR ROTORS AND 1 FUEL FILTER. CLEANED THE DISTRIBUTOR CAP NEEDLES AND CONTACTS. ADDED ONE FUEL TREATMENT TO THE GAS.	1.000	0.00	0.00	0.00	0.00
	<b>Tune Up / Scheduled Maintenance Subtotal:</b>		<b>0.00</b>	<b>0.00</b>	<b>0.00</b>	<b>0.00</b>
130965	SPARK PLUG	8.000	13.00	0.00	0.00	104.00
126139R	IGNITION ROTOR	2.000	70.00	0.00	0.00	140.00
	<b>Ignition System Subtotal:</b>		<b>244.00</b>	<b>0.00</b>	<b>0.00</b>	<b>244.00</b>
117792	FUEL FILTER \$11.04 FOR SHIPPING.	1.000	25.00	0.00	11.04	36.04
	<b>Fuel System Subtotal:</b>		<b>25.00</b>	<b>0.00</b>	<b>11.04</b>	<b>36.04</b>

Parts	269.00
Labor	0.00
<b>Subtotal</b>	<b>269.00</b>
Other Charges	11.04
<b>Total Due</b>	<b>280.04</b>

**Payment:**

Other (280.04)

**Thank You for choosing Merlin Auto Group!**



# ODD PARTS

18853 Orange  
Avenue  
Sonoma, CA 95476

## Invoice

DATE	Invoice
11/1/2018	5401

BILL TO	Merlin Auto Group Mitchel R. DeFrancis 2882 Amwiler Rd. Atlanta, GA 30360		
Merlin Auto Group Mitchel R. DeFrancis 2882 Amwiler Rd. Atlanta, GA 30360	P.O. NO.	TERMS	SHIP VIA
	Mitch	Due on receipt	USPS Priority

ITEM	DESCRIPTION	QTY	RATE	AMOUNT
Received Description	<p>DATE OF ARRIVAL: 11.02.2018 Via FedEx Signature Required</p> <p>ITEM : This is a Vitaloni switch from a Ferrari model: 328 GTS vehicle Chassis # ZFFXA20A2G0063077</p> <p>1. This switch assembly is complete with steering column surround cowling, wiring harness and harness sheath, Yet, Without Wiring harness cast plastic gang plugs.</p> <p>2. Item on switch that are clearly damaged or compromised include:</p> <p>A. Shrinkage damage to all three control arm stalk plastic</p> <p>B. Typical cracks ion twist switch contact holder plastic</p> <p>C. Missing black crinkle finish on cowling surround.</p> <p>D. Worn off plastic horn ring/cancelation wheel retainer tab on switch body.</p> <p>3. Missing items from this switch that may need replacement are:</p> <p>No parts missing- all parts intact</p> <p>4. Additional notes and/or requirements:</p> <p>As is typical of this model Vitaloni switch, all shrinkage prone plastic parts surrounding non-shrinking metal components are cracked- and should be reinforced or replaced.</p> <p>*** Notice that there are typical plastic shrinkage cracks at all three stalk arms where the original acetyl plastic was cast around the non-shrinking metal stalk arms. SEE PHOTOS.</p> <p>NOTE: that both twist switch drums ( headlamp and wiper) DO NOT currently have shrinkage cracks- This is unusual- as these thin plastic drums normally crack right through the red heat branded graphics on the thinner flat surfaces of the knobs. Because they are not cracked now- no action will be taken.</p>		0.00 0.00	0.00 0.00

DUE ON RECEIPT Thank you very much.		<b>Total</b>	
Web Site		<b>Sales Tax (8.5%)</b>	
Phone #	707 738 9661	<b>Subtotal</b>	
oddparts.net		<b>Payments/Credits</b>	
		<b>Customer Total Balance</b>	



# ODD PARTS

18853 Orange  
Avenue  
Sonoma, CA 95476

## Invoice

DATE	Invoice
11/1/2018	5401

BILL TO	SHIP TO		
Merlin Auto Group Mitchel R. DeFrancis 2882 Amwiler Rd. Atlanta, GA 30360	Merlin Auto Group Mitchel R. DeFrancis 2882 Amwiler Rd. Atlanta, GA 30360		
	P.O. NO.	TERMS	SHIP VIA
	Mitch	Due on receipt	USPS Priority

ITEM	DESCRIPTION	QTY	RATE	AMOUNT
Switch Labor 1	Recommended Repairs include: 1. Disassemble, clean, and detail all switch components. 2. Remove all shrinkage cracked plastic at all switch stalk arms where the original plastic was cast around non-shrinking metal arms. 3. Spot Weld two reinforcing steel wire loops to column end of metal switch arms that extends around the stalk arm pivot axis on switch body. 4. Immerse these reinforcing wires in non-shrinking acrylic plastic, and re-mold close to original shaped plastic components. 5. Final finish reinforced stalk arm replaced plastic in hard shell UV proof glossy black urethane coating that is better detailed than original. 6. Strip and re-electroplate original steel stalk arms in silver Zinc, and convert to black oxide where necessary. 7. Remove mold-parting-seams from original thumb paddles and control knobs, and buff to high luster. 8. Reinforce cracked twist-switch contact holder(s) using thin wall bronze sleeve pinned to stalk arm shaft, and backfill with non-shrinking acrylic plastic. 9. Reinforce weak turn signal canceler lugs using engine turned metal plate micro-screwed to plastic wheel. 10. Test and adjust turn signal mechanical cancelation mechanism. Test all electric contacts at 12 volts, 8 amps. 11. Etch this invoice number into body of switch for future identification.	11	95.00	1,045.00
LABOR INCOME	PRODUCTION LABOR (HOURS) *****ADDITIONAL REPAIRS IF AUTHORIZED***** 1. Mask, strip, etch., and Repaint cowl in Black crinkle finish paint. 2. No harm done to original serial number plaque.	2.5	95.00	237.50
Shop Supplies (In...	Materials and Supplies: Abrasives, adhesives, solvents, mold materials, casting plastics, hardware, shop supplies.	1	275.00	275.00
SHIPPING & HA...	SHIPPING AND HANDLING USPS priority Mail insured	1	28.55	28.55

DUE ON RECEIPT Thank you very much.		<b>Total</b>	
Web Site		<b>Sales Tax (8.5%)</b>	
Phone #		<b>Subtotal</b>	
707 738 9661		<b>Payments/Credits</b>	
oddparts.net		<b>Customer Total Balance</b>	



# ODD PARTS

18853 Orange  
Avenue  
Sonoma, CA 95476

## Invoice

DATE	Invoice
11/1/2018	5401

BILL TO	SHIP TO		
Merlin Auto Group Mitchel R. DeFrancis 2882 Amwiler Rd. Atlanta, GA 30360	Merlin Auto Group Mitchel R. DeFrancis 2882 Amwiler Rd. Atlanta, GA 30360		
	P.O. NO.	TERMS	SHIP VIA
	Mitch	Due on receipt	USPS Priority

ITEM	DESCRIPTION	QTY	RATE	AMOUNT
ESTIMATE	Authorization to Repair ( No Charge) 1. Photograph switch as received for communication and archiving. 2. Enlarge photos to display areas of concern and needed repairs. 3. Email these photos and illustration to customer for examination and authorization to proceed with restoration. 4. RECEIVED AUTHORIZATION to proceed with repairs : By whom <u>Mitch</u> Via <u>11</u> Date <u>11.04.2018</u> Emailed 11.19.2018 Emailed 01.06.2018		0.00	0.00

DUE ON RECEIPT Thank you very much.		<b>Total</b> \$1,586.05	
Web Site		<b>Sales Tax (8.5%)</b> \$0.00	
Phone #		<b>Subtotal</b>	
707 738 9661		<b>Payments/Credits</b> \$0.00	
oddparts.net		<b>Customer Total Balance</b> \$1,586.05	

# MERLIN AUTO GROUP

## Merlin Auto Group

2882 Amwiler Rd  
Atlanta GA 30360  
(B)(770) 457-2699

Invoice Date: 11/30/2018 10:03 AM

Technician: Phillip (15)

Customer Information	Vehicle Information
Merlin Auto Group 2882 Amwiler Rd Atlanta GA 30360 (B) (770)457-2699	1986 FERRARI 328 GTS VIN: ZFFXA20A2G0063077 License: Vehicle #P2776 Mileage (mi) 36,662 / 36,662

Operation/Part	Description	Quantity	Part	Labor	Other	Amount
INTA-L	REMOVE & INSTALL DASH TO SEND OUT FOR RE-UPHOLSTERY NEED 1 AIR VENT FOR DASH (THE MIDDLE ONE) NEED 2 TWEETERS FOR DASH 10/25/18 PW. DASH AND UPHOLSTERY REINSTALLED 11/1/18 PW.					1,138.50
BSHOP	REPAIRS MADE AND INSTALLED 11/00/18 .PW SUBLET TO ODD PARTS FOR STEERING SWITCH REBUILD	1.000	0.00	0.00	1,586.05	1,586.05
INTA-L	REMOVE AND REINSTALL STEERING COLUMN CONTROLS AND SEND OUT FOR REPAIR REBUILT STEERING SWITCH INSTALLED. 11/19/18 PW					165.00
	<b>Interior Subtotal:</b>		0.00	1,303.50	1,586.05	2,889.55
INT	SUBLET DASH TO NORTHPOINT UPHOLSTERY NORTHPOINT UPHOLSTERY RECOVERED THE DASH INV#5379	1.000	0.00	0.00	1,800.00	1,800.00
	<b>Recondition Subtotal:</b>		0.00	0.00	1,800.00	1,800.00
ELEC-L	PER WAF REPLACE THE TWEETERS COMPLETED 11/1/18 PW					165.00
MIC5132	2.5 INCH TWEETER SPEAKERS FOR 328	2.000	22.23	0.00	0.00	44.46
ELEC	Electrical Concern					165.00
ELEC	PER WAF APPROVING .05 HOURS OF DIAGNOSTIC TIME FOR TAG LIGHT REPAIRS MADE AT TIME OF DIAGNOSTIC 11/29/18 PW- DISASSEMBLED TAG LAMP ASSEMBLY AND REPAIRED/COMPLETE					82.50
	<b>Electrical Subtotal:</b>		44.46	412.50	0.00	456.96
BOD-L	PER WAF REPAIR DASH VENTS COMPLETED BY 10/26/18 PW	1.000	0.00	0.00	0.00	0.00
	<b>Body / Glass / Paint Subtotal:</b>		0.00	0.00	0.00	0.00
111189	FERRARI STEERING WHEEL BOLTS	6.000	5.85	0.00	0.00	35.10
	<b>Steering Subtotal:</b>		35.10	0.00	0.00	35.10

Thank You for choosing Merlin Auto Group!

# MERLIN AUTO GROUP

## Merlin Auto Group

2882 Amwiler Rd  
Atlanta GA 30360  
(B)(770) 457-2699

Invoice Date: 11/30/2018 10:03 AM

Technician: Phillip (15)

Customer Information	
Merlin Auto Group	
2882 Amwiler Rd	(B) (770)457-2699
Atlanta GA	
30360	

Vehicle Information	
1986 FERRARI 328 GTS	
VIN: ZFFXA20A2G0063077	
License:	Mileage (mi) 36,662 / 36,662
Vehicle #P2776	

Operation/Part	Description	Quantity	Part	Labor	Other	Amount
INSP3	Perform Phase 3 Inspection per waf sent 11/13/18 COMPLETED 11/00/18 PW					495.00
	<b>Inspection Subtotal:</b>		0.00	495.00	0.00	495.00
XBAT	PER WAF REPLACE THE BATTERY COMPLETED 11/00/18 PW.					165.00
MT34	INTERSTATE MT-34 BATTERY	1.000	128.64	0.00	0.00	128.64
NPA0465	NAPA 1/2" RUBBER/METAL CLAMP SET	1.000	7.36	0.00	0.00	7.36
	<b>Batteries Subtotal:</b>		136.00	165.00	0.00	301.00
SUSP	PER WAF REPLACE STEERING RACK					165.00
	STEERING RACK INSTALLED. WILL NEED AN ALIGNMENT 11/29/18 PW					
104498	FERRAR STEERING RACK FOR 308	1.000	686.67	0.00	0.00	686.67
108241U	FERRARI 308/328 STEERING RACK MOUNT - USED	1.000	90.00	0.00	0.00	90.00
	<b>Suspension Subtotal:</b>		776.67	165.00	0.00	941.67
						Parts 992.23
						Labor 2,541.00
						<b>Subtotal 3,533.23</b>
						Other Charges 3,386.05
						Shop Fee 100.00
						<b>Total Due 7,019.28</b>

Thank You for choosing Merlin Auto Group!

CUSTOMER #:

12812

MERLIN AUTO GROUP

2882 AMWILER RD  
ATLANTA, GA 30360  
(770) 457-2699  
www.merlinautogroup.com

MERLIN AUTO GROUP  
2882 AMWILLER RD  
ATLANTA GA 30360

PAGE 1

HOME: CONT:N/A  
BUS: CELL:

SERVICE ADVISOR: 117 MARK MCDANIEL

COLOR	YEAR	MAKE/MODEL		VIN		LICENSE	MILEAGE IN / OUT		TAG
YELLOW	86	FERRARI 328		ZFFXA20A2G0063077			36718/36718		T2812
DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED		PO NO.	RATE	PAYMENT	INV. DATE	
DD			18:00 23FEB24			250.00	CASH	29FEB24	
R.O. OPENED		READY		OPTIONS: STK:P2776 ENG:3.2L V8 TRN:MANUAL					

12:15 23FEB24	12:59 29FEB24							
LINE	OPCODE	TECH	TYPE	A/HRS	S/HRS	LIST	NET	TOTAL
A	REPLACE	12V	BATTERY					
CAUSE: POOR BATTERY PERFORMANCE								
BATT REPLACE 12V BATTERY								

1 MT34 INTERSTATE BATTERY							
MT34							
PARTS:	175.44	LABOR:	250.00	OTHER:	0.00	TOTAL LINE A:	425.44
36718 POOR BATTERY PERFORMANCE REPLACED BATTERY DUE TO NOT							
ACCEPTING CHARGE. COMPLETE.							

<b>WARRANTY DISCLAIMER:</b> ALL PARTS AND ACCESSORIES ARE SOLD AND ALL REPAIRS ARE PROVIDED BY THE DEALERSHIP AS-IS. THE DEALERSHIP HEREBY EXPRESSLY DISCLAIMS ALL WARRANTIES, EXPRESS AND IMPLIED, INCLUDING ANY IMPLIED WARRANTIES OF MERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE, AND NEITHER ASSUMES NOR AUTHORIZES ANY OTHER PERSON TO ASSUME FOR IT ANY LIABILITY IN CONNECTION WITH THE SALE OF PARTS OR PRODUCTS OR THE REPAIR. THE ONLY WARRANTIES ON PARTS AND ACCESSORIES OR REPAIRS ARE THOSE WHICH MAY BE OFFERED BY THE MANUFACTURER OR THE ORIGINAL PARTS DISTRIBUTOR AND ONLY SUCH MANUFACTURER OR DISTRIBUTOR SHALL BE LIABLE FOR PERFORMANCE UNDER SUCH WARRANTIES. CUSTOMER SHALL NOT BE ENTITLED TO RECOVER FROM THE DEALERSHIP ANY CONSEQUENTIAL DAMAGES, DAMAGES TO PROPERTY, DAMAGES FOR LOSS OF USE, LOSS OF TIME, LOSS OF PROFIT OR INCOME, OR ANY OTHER INCIDENTAL DAMAGES. By signing below, you acknowledge that you were notified of and authorized the Dealership to perform the services/repairs itemized in this invoice and that you received (or had the opportunity to inspect) any replaced parts as requested by you. The vehicle is being returned to you in exchange for your payment of the Amount Due.		<b>*SHOP SUPPLY COSTS:</b> A charge equal to 5% of the total cost of parts and labor will be added to the Repair Order for shop supplies used in connection with the repair		DESCRIPTION	TOTALS
		<b>ALL PARTS ARE NEW UNLESS OTHERWISE INDICATED.</b>		LABOR AMOUNT	0.00
				PARTS AMOUNT	0.00
				GAS, OIL, LUBE	0.00
				SUBLET AMOUNT	0.00
				MISC. CHARGES *	0.00
				TOTAL CHARGES	0.00
				LESS INSURANCE	0.00
				SALES TAX	0.00
DATE		CUSTOMER SIGNATURE		AUTHORIZED DEALERSHIP REPRESENTATIVE SIGNATURE	
				<b>PLEASE PAY THIS AMOUNT</b>	0.00