

11121

INVOICE

DUPLICATE 3
PAGE 1

MERLIN AUTO GROUP

2882 AMWILER RD
ATLANTA, GA 30360
(770) 457-2699
www.merlinautogroup.com

SERVICE ADVISOR: 113 ERIC CHIARELLI

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG	
RED	07	FERRARI F430	ZFFEW58A670153265		17316/17334	T121	
DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
14AUG21 DD			18:00 01DEC21		180.00	CASH	30DEC21
R.O. OPENED	READY	OPTIONS: SOLD-STK:P153265					
11:37 01DEC21	16:39 30DEC21						

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

A CUSTOMER STATES THE CHECK ENGINE LIGHT IS ON. PLEASE CHECK AND ADVISE.

CAUSE: Error for gross EVAP leak
CEL CHECK ENGINE LIGHT IS ON. PULL CODE(S) AND PERFORM INITIAL DIAGNOSTICS

- 1011SALE (N/C)
- 1141SALE (N/C)
- 2 53601570 OETIKER CLAMP 15.7 (N/C)
- 1 046.6.16 PH PAN SCREW MS M6X16X1 (N/C)

17316 Error for gross EVAP leak Inspection found an error for a gross EVAP leak. Performed smoke test on EVAP system; no leaks found at this time. Cleared codes, test drove car, code did not return.

B CUSTOMER STATES THE CAR FEELS LIKE IT MAY HAVE A SLIGHT VIBRATION IN THE LOWER GEARS, SPEED DEPENDENT. PLEASE CHECK AND ADVISE.

MISC TEST DROVE CAR, INCLUDING DELIVERY TO THE CUSTOMER'S HOME. THE VEHICLE IS NOT EXHIBITING ANY ABNORMAL DRIVEABILITY TRAITS.

1131SALE (N/C)

17316 CAR WAS TEST DRIVEN AS WELL AS DRIVEN TO CUSTOMER'S HOME. NO ABNORMAL VIBRATION FELT IN LOWER GEARS. THE F1 TRANSMISSION IS EFFECTIVELY A MANUAL WITH AN AUTOMATIC CLUTCH, SO SOME "LURCHING" MAY BE FELT AT LOW SPEEDS IF THE ENGINE RPM IS BELOW OPTIMUM FOR THE SPEED/GEAR AT THE TIME.

WARRANTY DISCLAIMER: ALL PARTS AND ACCESSORIES ARE SOLD AND ALL REPAIRS ARE PROVIDED BY THE DEALERSHIP AS-IS. THE DEALERSHIP HEREBY EXPRESSLY DISCLAIMS ALL WARRANTIES, EXPRESS AND IMPLIED, INCLUDING ANY IMPLIED WARRANTIES OF MERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE, AND NEITHER ASSUMES NOR AUTHORIZES ANY OTHER PERSON TO ASSUME FOR IT ANY LIABILITY IN CONNECTION WITH THE SALE OF PARTS OR PRODUCTS OR THE REPAIR. THE ONLY WARRANTIES ON PARTS AND ACCESSORIES OR REPAIRS ARE THOSE WHICH MAY BE OFFERED BY THE MANUFACTURER OR THE ORIGINAL PARTS DISTRIBUTOR AND ONLY SUCH MANUFACTURER OR DISTRIBUTOR SHALL BE LIABLE FOR PERFORMANCE UNDER SUCH WARRANTIES. CUSTOMER SHALL NOT BE ENTITLED TO RECOVER FROM THE DEALERSHIP ANY CONSEQUENTIAL DAMAGES, DAMAGES TO PROPERTY, DAMAGES FOR LOSS OF USE, LOSS OF TIME, LOSS OF PROFIT OR INCOME, OR ANY OTHER INCIDENTAL DAMAGES. By signing below, you acknowledge that you were notified of and authorized the Dealership to perform the services/repairs itemized in this invoice and that you received (or had the opportunity to inspect) any replaced parts as requested by you. The vehicle is being returned to you in exchange for your payment of the Amount Due.	*SHOP SUPPLY COSTS: We have added a charge equal to 15% of the total cost of labor and parts, not to exceed \$20.00, to the Repair Order for shop supplies used in connection with this repair.	DESCRIPTION	TOTALS
	ALL PARTS ARE NEW UNLESS OTHERWISE INDICATED.	LABOR AMOUNT	0.00
		PARTS AMOUNT	0.00
		GAS, OIL, LUBE	0.00
		SUBLET AMOUNT	0.00
		MISC. CHARGES *	0.00
		TOTAL CHARGES	0.00
		LESS INSURANCE	0.00
		SALES TAX	0.00
	DATE	CUSTOMER SIGNATURE	AUTHORIZED DEALERSHIP REPRESENTATIVE SIGNATURE
			0.00

11338

INVOICE

DUPLICATE 1
PAGE 1

MERLIN AUTO GROUP

2882 AMWILER RD
ATLANTA, GA 30360
(770) 457-2699
www.merlinautogroup.com

SERVICE ADVISOR: 111 DANIEL JOFFE

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG	
RED	07	FERRARI F430	ZFFEW58A670153265		17863/17883	T338	
DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
14AUG21 DD			18:00 09MAR22		180.00	CASH	17MAR22
R.O. OPENED	READY	OPTIONS: SOLD-STK:P153265					
13:25 09MAR22	15:07 17MAR22						

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

A CHECK ENGINE LIGHT IS ON. PULL CODE(S) AND PERFORM INITIAL DIAGNOSTICS

CAUSE: Emissions pump

CEL FOUND FAILING EMISSIONS PUMP, REPLACED AND CLEARED CODES, TEST DROVE AND VEHICLE NOT PRODUCING ANY CODES

101ISALE

1 251288 FERRARI DIAGNOSTIC PUMP 0261222018

1 52545K28 OETIKER CLAMP 24.1 #16700029

(N/C)
(N/C)
(N/C)

17863 Emissions pump Inspection found an error for evap gross leak. Need to order an emissions pump. Ordered the pump and installed it. Will test drive to confirm.

B CHECK THE TRANSMISSION, CUSTOMER STATES IT DOESN'T SEEM TO FEEL RIGHT

CAUSE: No issue

MISC NO ISSUES FOUND

101ISALE

(N/C)

MISC ADDED FUEL TO VEHICLE

ISALE

(N/C)

17863 No issue Test drive found no issues.

WARRANTY DISCLAIMER: ALL PARTS AND ACCESSORIES ARE SOLD AND ALL REPAIRS ARE PROVIDED BY THE DEALERSHIP AS-IS. THE DEALERSHIP HEREBY EXPRESSLY DISCLAIMS ALL WARRANTIES, EXPRESS AND IMPLIED, INCLUDING ANY IMPLIED WARRANTIES OF MERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE, AND NEITHER ASSUMES NOR AUTHORIZES ANY OTHER PERSON TO ASSUME FOR IT ANY LIABILITY IN CONNECTION WITH THE SALE OF PARTS OR PRODUCTS OR THE REPAIR. THE ONLY WARRANTIES ON PARTS AND ACCESSORIES OR REPAIRS ARE THOSE WHICH MAY BE OFFERED BY THE MANUFACTURER OR THE ORIGINAL PARTS DISTRIBUTOR AND ONLY SUCH MANUFACTURER OR DISTRIBUTOR SHALL BE LIABLE FOR PERFORMANCE UNDER SUCH WARRANTIES. CUSTOMER SHALL NOT BE ENTITLED TO RECOVER FROM THE DEALERSHIP ANY CONSEQUENTIAL DAMAGES, DAMAGES TO PROPERTY, DAMAGES FOR LOSS OF USE, LOSS OF TIME, LOSS OF PROFIT OR INCOME, OR ANY OTHER INCIDENTAL DAMAGES.

By signing below, you acknowledge that you were notified of and authorized the Dealership to perform the services/repairs itemized in this invoice and that you received (or had the opportunity to inspect) any replaced parts as requested by you. The vehicle is being returned to you in exchange for your payment of the Amount Due.

***SHOP SUPPLY COSTS:**

A charge equal to 5% of the total cost of parts and labor will be added to the Repair Order for shop supplies used in connection with the repair.

ALL PARTS ARE NEW UNLESS OTHERWISE INDICATED.

DESCRIPTION	TOTALS
LABOR AMOUNT	0.00
PARTS AMOUNT	0.00
GAS, OIL, LUBE	0.00
SUBLET AMOUNT	0.00
MISC. CHARGES *	0.00
TOTAL CHARGES	0.00
LESS INSURANCE	0.00
SALES TAX	0.00
PLEASE PAY THIS AMOUNT	0.00

DATE CUSTOMER SIGNATURE AUTHORIZED DEALERSHIP REPRESENTATIVE SIGNATURE

12204

INVOICE

PAGE 1

MERLIN AUTO GROUP

2882 AMWILER RD
ATLANTA, GA 30360
(770) 457-2699
www.merlinautogroup.com

SERVICE ADVISOR: 117 MARK MCDANIEL

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG	
RED	07	FERRARI F430	ZFFEW58A670153265		18574/18579	T2204	
DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
14AUG21 DD			18:00 12MAY23		225.00	CASH	06JUL23
R.O. OPENED		READY	OPTIONS: SOLD-STK:P153265				
14:48 12MAY23		12:37 06JUL23					

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

A PERFORM FULL VEHICLE COMPLIMENTARY MULTI-POINT INSPECTION, CK FOR SERVICE NEEDS,

CAUSE: PERFORM FULL VEHICLE MULTI-POINT INSPECTION
MPI PERFORM FULL VEHICLE COMPLIMENTARY MULTI-POINT INSPECTION

114 ISP (N/C)
PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE A: 0.00
18574 Performed multi-point inspection. See sheet.

B CHECK ENGINE LIGHT IS ON. PULL CODE(S) AND PERFORM INITIAL DIAGNOSTICS

CEL CHECK ENGINE LIGHT IS ON. PULL CODE(S) AND PERFORM INITIAL DIAGNOSTICS

114 CU 225.00 225.00
PARTS: 0.00 LABOR: 225.00 OTHER: 0.00 TOTAL LINE B: 225.00

18574 Scanned the system and found a "low purge flow" fault for evaporative emissions was stored but not an active fault at that time. Cleared the fault and performed an extensive test drive with no return of the light. Checked and found that emissions readiness monitors were clicked off. Car was taken to a local emission test station and emissions test was passed.

C** OIL AND FILTER CHANGE, REPLACE OTHER FLUIDS AND FILTERS AS NEEDED
STDANNUAL OIL AND FILTER CHANGE, REPLACE OTHER FLUIDS AND FILTERS AS NEEDED

114 CU 900.00 900.00
1 234742 FERRARI OIL FILTER 430/CALIFORNIA 67.72
1 10261860 COPPER WASHER M22 X 29 4602229 5.25
1 10265060 COPPER WASHER 32X38 3.95
1 65384300 FERRARI CABIN POLLEN FILTER 360/430 88.45
10 PEN5W40 PENNZOIL 5W40 150.00
1 601458 SYNTHETIC DOT 3 AND 4 BRAKE FLUID 1QT 28.65
1 WIN0109 WINTER BRAKE PARTS CLEANER -
ORIGINAL FORMULA 8914520 10.25

WARRANTY DISCLAIMER: ALL PARTS AND ACCESSORIES ARE SOLD AND ALL REPAIRS ARE PROVIDED BY THE DEALERSHIP AS-IS. THE DEALERSHIP HEREBY EXPRESSLY DISCLAIMS ALL WARRANTIES, EXPRESS AND IMPLIED, INCLUDING ANY IMPLIED WARRANTIES OF MERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE AND NEITHER ASSUMES NOR AUTHORIZES ANY OTHER PERSON TO ASSUME FOR IT ANY LIABILITY IN CONNECTION WITH THE SALE OF PARTS OR PRODUCTS OR THE REPAIR. THE ONLY WARRANTIES ON PARTS AND ACCESSORIES OR REPAIRS ARE THOSE WHICH MAY BE OFFERED BY THE MANUFACTURER OR THE ORIGINAL PARTS DISTRIBUTOR AND ONLY SUCH MANUFACTURER OR DISTRIBUTOR SHALL BE LIABLE FOR PERFORMANCE UNDER SUCH WARRANTIES. CUSTOMER SHALL NOT BE ENTITLED TO RECOVER FROM THE DEALERSHIP ANY CONSEQUENTIAL DAMAGES, DAMAGES TO PROPERTY, DAMAGES FOR LOSS OF USE, LOSS OF TIME, LOSS OF PROFIT OR INCOME, OR ANY OTHER INCIDENTAL DAMAGES. By signing below, you acknowledge that you were notified of and authorized the Dealership to perform the services/repairs itemized in this Invoice and that you received (or had the opportunity to inspect) any replaced parts as requested by you. The vehicle is being returned to you in exchange for your payment of the Amount Due.	*SHOP SUPPLY COSTS: A charge equal to 5% of the total cost of parts and labor will be added to the Repair Order for shop supplies used in connection with the repair.	DESCRIPTION	TOTALS
		LABOR AMOUNT	
		PARTS AMOUNT	
		GAS, OIL, LUBE	
		SUBLET AMOUNT	
		MISC. CHARGES *	
		TOTAL CHARGES	
ALL PARTS ARE NEW UNLESS OTHERWISE INDICATED.	LESS INSURANCE		
	SALES TAX		
DATE	CUSTOMER SIGNATURE	AUTHORIZED DEALERSHIP REPRESENTATIVE SIGNATURE	PLEASE PAY THIS AMOUNT

12204

INVOICE

PAGE 2

MERLIN AUTO GROUP

2882 AMWILER RD
ATLANTA, GA 30360
(770) 457-2699
www.merlinautogroup.com

SERVICE ADVISOR: 117 MARK MCDANIEL

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG	
RED	07	FERRARI F430	ZFFEW58A670153265		18574/18579	T2204	
DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
14AUG21 DD			18:00 12MAY23		225.00	CASH	06JUL23

R.O. OPENED	READY	OPTIONS:	SOLD-STK:P153265
14:48 12MAY23	12:37 06JUL23		

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
1	12641378	FERRARI	WASHER	7-35X2	599/612		5.25
2	HARDWARE	HARDWARE	1				2.50

SUBL FUEL
CU 18.00 18.00
PARTS: 362.02 LABOR: 900.00 OTHER: 18.00 TOTAL LINE C: 1280.02
18574 Changed oil and filter. Flushed brake fluid and replaced pollen filter.

E** INSPECT AND PLUG/REPAIR TIRE
CAUSE: REPAIR AND PLUG TIRE IF POSSIBLE
PLUG INSPECT AND PLUG/REPAIR TIRE
114 ISP (N/C)
PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE E: 0.00
18574 Removed very short screw. No plug necessary.

F** PERFORM EMISSIONS INSPECTION
CAUSE: PERFORM EMISSIONS INSPECTION
EMI PERFORM EMISSIONS INSPECTION
99 CU
114 CU 0.00 0.00
SUBL EMISSIONS TEST

CU 25.00 25.00
PARTS: 0.00 LABOR: 0.00 OTHER: 25.00 TOTAL LINE F: 25.00

G** REPLACE PASS SIDE MIRROR.
CAUSE: Broken Mirror
BODY R&R PASSENGER SIDE MIRROR
101 ISP (N/C)
1 68736310 RH DOOR MIRROR (N/C)
SUBL PAINT MIRROR ASSEMBLY
ISP (N/C)
PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE G: 0.00
18574 Broken Mirror Passenger mirror had broken, new one was

WARRANTY DISCLAIMER: ALL PARTS AND ACCESSORIES ARE SOLD AND ALL REPAIRS ARE PROVIDED BY THE DEALERSHIP AS-IS. THE DEALERSHIP HEREBY EXPRESSLY DISCLAIMS ALL WARRANTIES, EXPRESS AND IMPLIED, INCLUDING ANY IMPLIED WARRANTIES OF MERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE, AND NEITHER ASSUMES NOR AUTHORIZES ANY OTHER PERSON TO ASSUME FOR IT ANY LIABILITY IN CONNECTION WITH THE SALE OF PARTS OR PRODUCTS OR THE REPAIR. THE ONLY WARRANTIES ON PARTS AND ACCESSORIES OR REPAIRS ARE THOSE WHICH MAY BE OFFERED BY THE MANUFACTURER OR THE ORIGINAL PARTS DISTRIBUTOR AND ONLY SUCH MANUFACTURER OR DISTRIBUTOR SHALL BE LIABLE FOR PERFORMANCE UNDER SUCH WARRANTIES. CUSTOMER SHALL NOT BE ENTITLED TO RECOVER FROM THE DEALERSHIP ANY CONSEQUENTIAL DAMAGES, DAMAGES TO PROPERTY, DAMAGES FOR LOSS OF USE, LOSS OF TIME, LOSS OF PROFIT OR INCOME, OR ANY OTHER INCIDENTAL DAMAGES. By signing below, you acknowledge that you were notified of and authorized the Dealership to perform the services/repairs itemized in this Invoice and that you received (or had the opportunity to inspect) any replaced parts as requested by you. The vehicle is being returned to you in exchange for your payment of the Amount Due.	* SHOP SUPPLY COSTS: A charge equal to 5% of the total cost of parts and labor will be added to the Repair Order for shop supplies used in connection with the repair.	DESCRIPTION	TOTALS
	LABOR AMOUNT		
	PARTS AMOUNT		
	GAS, OIL, LUBE		
	SUBLET AMOUNT		
	MISC. CHARGES *		
	TOTAL CHARGES		
	LESS INSURANCE		
	SALES TAX		
	DATE	CUSTOMER SIGNATURE	AUTHORIZED DEALERSHIP REPRESENTATIVE SIGNATURE

12204

INVOICE

PAGE 3

MERLIN AUTO GROUP

2882 AMWILER RD
ATLANTA, GA 30360
(770) 457-2699
www.merlinautogroup.com

SERVICE ADVISOR: 117 MARK MCDANIEL

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG	
RED	07	FERRARI F430	ZFFEW58A670153265		18574/18579	T2204	
DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
14AUG21 DD			18:00 12MAY23		225.00	CASH	06JUL23
R.O. OPENED	READY	OPTIONS: SOLD-STK:P153265					
14:48 12MAY23	12:37 06JUL23						
LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL

ordered and painted. It has arrived back from paint. R&R passenger door panel and install mirror.

H** REMOVE FUEL DOOR LID FOR COLOR MATCHING.

CAUSE: Removed For Sample
BODY R&R FUEL DOOR LID
101 ISP

(N/C)

PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE H: 0.00

18574 Removed For Sample
Gas door was removed and sent to the body shop to match paint on the replacement mirror.
I installed it and adjusted it after the mirror returned.

WARRANTY DISCLAIMER: ALL PARTS AND ACCESSORIES ARE SOLD AND ALL REPAIRS ARE PROVIDED BY THE DEALERSHIP AS-IS. THE DEALERSHIP HEREBY EXPRESSLY DISCLAIMS ALL WARRANTIES, EXPRESS AND IMPLIED, INCLUDING ANY IMPLIED WARRANTIES OF MERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE, AND NEITHER ASSUMES NOR AUTHORIZES ANY OTHER PERSON TO ASSUME FOR IT ANY LIABILITY IN CONNECTION WITH THE SALE OF PARTS OR PRODUCTS OR THE REPAIR. THE ONLY WARRANTIES ON PARTS AND ACCESSORIES OR REPAIRS ARE THOSE WHICH MAY BE OFFERED BY THE MANUFACTURER OR THE ORIGINAL PARTS DISTRIBUTOR AND ONLY SUCH MANUFACTURER OR DISTRIBUTOR SHALL BE LIABLE FOR PERFORMANCE UNDER SUCH WARRANTIES. CUSTOMER SHALL NOT BE ENTITLED TO RECOVER FROM THE DEALERSHIP ANY CONSEQUENTIAL DAMAGES, DAMAGES TO PROPERTY, DAMAGES FOR LOSS OF USE, LOSS OF TIME, LOSS OF PROFIT OR INCOME, OR ANY OTHER INCIDENTAL DAMAGES.

By signing below, you acknowledge that you were notified of and authorized the Dealership to perform the services/repairs itemized in this Invoice and that you received (or had the opportunity to inspect) any replaced parts as requested by you. The vehicle is being returned to you in exchange for your payment of the Amount Due.

*** SHOP SUPPLY COSTS:**
A charge equal to 5% of the total cost of parts and labor will be added to the Repair Order for shop supplies used in connection with the repair.

ALL PARTS ARE NEW UNLESS OTHERWISE INDICATED.

DESCRIPTION	TOTALS
LABOR AMOUNT	1125.00
PARTS AMOUNT	362.02
GAS, OIL, LUBE	0.00
SUBLET AMOUNT	43.00
MISC. CHARGES *	74.35
TOTAL CHARGES	1604.37
LESS INSURANCE	0.00
SALES TAX	25.34
PLEASE PAY THIS AMOUNT	1629.71

DATE CUSTOMER SIGNATURE AUTHORIZED DEALERSHIP REPRESENTATIVE SIGNATURE

12501

INVOICE

PAGE 1

MERLIN AUTO GROUP

2882 AMWILER RD
ATLANTA, GA 30360
(770) 457-2699
www.merlinautogroup.com

SERVICE ADVISOR: 117 MARK MCDANIEL

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG	
RED	07	FERRARI F430	ZFFEW58A670153265		18895/18898	T12501	
DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
14AUG21 DD			18:00 21SEP23		235.00	AE	24OCT23
R.O. OPENED		READY	OPTIONS: SOLD-STK:P153265				
12:44 21SEP23		09:32 24OCT23					
LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL

A DIAGNOSE FUEL SMELL FROM ENGINE BAY.

CAUSE: FUEL PUMP LEAKING

FUELSYS DIAGNOSIS

121 CU

112.50 112.50

PARTS: 0.00 LABOR: 112.50 OTHER: 0.00 TOTAL LINE A: 112.50

18895 FUEL PUMP LEAKING Removed engine bay panels to further investigate fuel smell. Found the left hand side fuel pump leaking badly. Replacement needed.

B** VEHICLE TRANSPORT

TRANSPORT VEHICLE TRANSPORT

99 CU

0.00 0.00

FRT-S TRANSPORT VEHICLE FROM MARIETTA TO MAG

225.00 225.00

PARTS: 0.00 LABOR: 0.00 OTHER: 225.00 TOTAL LINE B: 225.00

C** REPLACE DRIVERS SIDE FUEL PUMP.

CAUSE: Leaking Left side fuel pump

FUELSYS R&R LEFT FUEL PUMP AND SENDING UNIT

125 CU

1575.00 1575.00

2 52545K81 OETIKER CLAMP 34.9 TO 38.1MM 10.00

1 52545K55 14.5 TO 17MM OETIKER CLAMP 1.50

1 181682 FERRARI PUMP FASTENING RING NUT 55.76

1 181681 FERRARI/MASERATI FUEL PUMP GASKET

360/430/575/599/612 55.31

1 239821 LH FUEL PUMP 954.00

1 60711900 FERRARI 6 X 2 SILVER WASHER FLOOR

PAN BODY SHIELDS 1.50

2 5393250 HOSE CLAMP M32X50 16.00

1 HARDWARE HARDWARE1 1.25

PARTS: 1095.32 LABOR: 1575.00 OTHER: 0.00 TOTAL LINE C: 2670.32

18898 Leaking Left side fuel pump Found left side fuel pump leaking from the pump cover assembly. Required the replacement of the fuel pump (which included the fuel gauge level sender, which is included in the

WARRANTY DISCLAIMER:	* SHOP SUPPLY COSTS:	DESCRIPTION	TOTALS
<p>ALL PARTS AND ACCESSORIES ARE SOLD AND ALL REPAIRS ARE PROVIDED BY THE DEALERSHIP AS-IS. THE DEALERSHIP HEREBY EXPRESSLY DISCLAIMS ALL WARRANTIES, EXPRESS AND IMPLIED, INCLUDING ANY IMPLIED WARRANTIES OF MERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE, AND NEITHER ASSUMES NOR AUTHORIZES ANY OTHER PERSON TO ASSUME FOR IT ANY LIABILITY IN CONNECTION WITH THE SALE OF PARTS OR PRODUCTS OR THE REPAIR. THE ONLY WARRANTIES ON PARTS AND ACCESSORIES OR REPAIRS ARE THOSE WHICH MAY BE OFFERED BY THE MANUFACTURER OR THE ORIGINAL PARTS DISTRIBUTOR AND ONLY SUCH MANUFACTURER OR DISTRIBUTOR SHALL BE LIABLE FOR PERFORMANCE UNDER SUCH WARRANTIES. CUSTOMER SHALL NOT BE ENTITLED TO RECOVER FROM THE DEALERSHIP ANY CONSEQUENTIAL DAMAGES, DAMAGES TO PROPERTY, DAMAGES FOR LOSS OF USE, LOSS OF TIME, LOSS OF PROFIT OR INCOME, OR ANY OTHER INCIDENTAL DAMAGES.</p> <p>By signing below, you acknowledge that you were notified of and authorized the Dealership to perform the services/repairs itemized in this Invoice and that you received (or had the opportunity to inspect) any replaced parts as requested by you. The vehicle is being returned to you in exchange for your payment of the Amount Due.</p>	<p>A charge equal to 5% of the total cost of parts and labor will be added to the Repair Order for shop supplies used in connection with the repair.</p>	LABOR AMOUNT	
		PARTS AMOUNT	
		GAS, OIL, LUBE	
		SUBLET AMOUNT	
		MISC. CHARGES *	
		TOTAL CHARGES	
		LESS INSURANCE	
		SALES TAX	
		ALL PARTS ARE NEW UNLESS OTHERWISE INDICATED.	
		PLEASE PAY THIS AMOUNT	
DATE	CUSTOMER SIGNATURE	AUTHORIZED DEALERSHIP REPRESENTATIVE SIGNATURE	

12501

INVOICE

PAGE 2

MERLIN AUTO GROUP

2882 AMWILER RD
ATLANTA, GA 30360
(770) 457-2699
www.merlinautogroup.com

SERVICE ADVISOR: 117 MARK MCDANIEL

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG	
RED	07	FERRARI F430	ZFFEW58A670153265		18895/18898	T12501	
DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
14AUG21 DD			18:00 21SEP23		235.00	AE	24OCT23
R.O. OPENED		READY	OPTIONS: SOLD-STK:P153265				
12:44 21SEP23		09:32 24OCT23					

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

unit). Removal of the fuel pump required draining all fuel from the tanks, removal of the 2 rear under body panels, the left rear wheel, left rear inner fender liners, the left side engine bay covers, left side engine bay heat shield, left side pre cat o2 sensor, and all left side fuel tank hoses/brackets/clamps. After removal or the old pump and the installation of the new unit (which included a new tank o-ring and plastic clamping ring), the fuel tank and all the hardware were reinstalled. After reinstalling the fuel tank, it was partially filled with fuel, and it was verified that the fuel pump and the fuel gauge level sensor were functioning properly. All other components were then reinstalled and then a test drive was performed to verify that the vehicle was operating correctly and the fuel odor had been eliminated.

WARRANTY DISCLAIMER: ALL PARTS AND ACCESSORIES ARE SOLD AND ALL REPAIRS ARE PROVIDED BY THE DEALERSHIP AS-IS. THE DEALERSHIP HEREBY EXPRESSLY DISCLAIMS ALL WARRANTIES, EXPRESS AND IMPLIED, INCLUDING ANY IMPLIED WARRANTIES OF MERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE, AND NEITHER ASSUMES NOR AUTHORIZES ANY OTHER PERSON TO ASSUME FOR IT ANY LIABILITY IN CONNECTION WITH THE SALE OF PARTS OR PRODUCTS OR THE REPAIR. THE ONLY WARRANTIES ON PARTS AND ACCESSORIES OR REPAIRS ARE THOSE WHICH MAY BE OFFERED BY THE MANUFACTURER OR THE ORIGINAL PARTS DISTRIBUTOR AND ONLY SUCH MANUFACTURER OR DISTRIBUTOR SHALL BE LIABLE FOR PERFORMANCE UNDER SUCH WARRANTIES. CUSTOMER SHALL NOT BE ENTITLED TO RECOVER FROM THE DEALERSHIP ANY CONSEQUENTIAL DAMAGES, DAMAGES TO PROPERTY, DAMAGES FOR LOSS OF USE, LOSS OF TIME, LOSS OF PROFIT OR INCOME, OR ANY OTHER INCIDENTAL DAMAGES.

By signing below, you acknowledge that you were notified of and authorized the Dealership to perform the services/repairs itemized in this invoice and that you received (or had the opportunity to inspect) any replaced parts as requested by you. The vehicle is being returned to you in exchange for your payment of the Amount Due.

*** SHOP SUPPLY COSTS:**

A charge equal to 5% of the total cost of parts and labor will be added to the Repair Order for shop supplies used in connection with the repair.

ALL PARTS ARE NEW UNLESS OTHERWISE INDICATED.

DESCRIPTION	TOTALS
LABOR AMOUNT	1687.50
PARTS AMOUNT	1095.32
GAS, OIL, LUBE	0.00
SUBLET AMOUNT	0.00
MISC. CHARGES *	364.15
TOTAL CHARGES	3146.97
LESS INSURANCE	0.00
SALES TAX	76.67
PLEASE PAY THIS AMOUNT	3223.64

DATE CUSTOMER SIGNATURE AUTHORIZED DEALERSHIP REPRESENTATIVE SIGNATURE

12444

INVOICE

PAGE 1

MERLIN AUTO GROUP

2882 AMWILER RD
ATLANTA, GA 30360
(770) 457-2699
www.merlinautogroup.com

SERVICE ADVISOR: 117 MARK MCDANIEL

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG	
RED	07	FERRARI F430	ZFFEW58A670153265		18822/18822	T2444	
DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
14AUG21 DD			18:00 28AUG23		235.00	AE	24OCT23

R.O. OPENED READY OPTIONS: SOLD-STK:P153265

11:44 28AUG23 09:31 24OCT23

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

A VEHICLE TRANSPORT

TRANSPORT VEHICLE TRANSPORT

99 CU
101 CU

0.00 0.00

FRT-S TRANSPORT VEHICLE FROM MARIETTA TO MAG

225.00 225.00

PARTS: 0.00 LABOR: 0.00 OTHER: 225.00 TOTAL LINE A: 225.00

B** CUSTOMER STATES HE SAW SMOKE COMING FROM THE ENGINE BAY AREA. CHECK AND ADVISE.

CAUSE: RIGHT INNER BOOT TORN FOR AXLE

DIAG DIAGNOSE

102 CU
1 70000868 FERRARI CV BOOT KIT 355
2 52545K81 OETIKER CLAMP 34.9 TO 38.1MM
1 209184 FERRARI AXLE NUT 355/430/360/512

1462.50 1462.50
220.16
10.00
59.26

PARTS: 289.42 LABOR: 1462.50 OTHER: 0.00 TOTAL LINE B: 1751.92

18822 RIGHT INNER BOOT TORN FOR AXLE R&R UNDER TRAYS TO CHECK FOR POSSIBLE CAUSE OF SMOKE. FOUND RIGHT SIDE AXLE BOOT TORN CAUSING GREASE TO GET ON HEADER ASSEMBLY. R&R RIGHT AXLE TO REPLACE BOTH BOOTS. CLEANED AREA AND TEST DROVE.

C** CHECK ENGINE LIGHT IS ON. PULL CODE(S) AND PERFORM INITIAL DIAGNOSTICS

CEL CHECK ENGINE LIGHT IS ON. PULL CODE(S) AND PERFORM INITIAL DIAGNOSTICS

102 CU
101 CU

200.00 200.00

5 53601570 OETIKER CLAMP 15.7

20.00

PARTS: 20.00 LABOR: 200.00 OTHER: 0.00 TOTAL LINE C: 220.00

18822 PERFORMED DIAGNOSTIC CHECKS WITH TEST BOX. FOUND CODES

WARRANTY DISCLAIMER: ALL PARTS AND ACCESSORIES ARE SOLD AND ALL REPAIRS ARE PROVIDED BY THE DEALERSHIP AS-IS. THE DEALERSHIP HEREBY EXPRESSLY DISCLAIMS ALL WARRANTIES, EXPRESS AND IMPLIED, INCLUDING ANY IMPLIED WARRANTIES OF MERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE, AND NEITHER ASSUMES NOR AUTHORIZES ANY OTHER PERSON TO ASSUME FOR IT ANY LIABILITY IN CONNECTION WITH THE SALE OF PARTS OR PRODUCTS OR THE REPAIR. THE ONLY WARRANTIES ON PARTS AND ACCESSORIES OR REPAIRS ARE THOSE WHICH MAY BE OFFERED BY THE MANUFACTURER OR THE ORIGINAL PARTS DISTRIBUTOR AND ONLY SUCH MANUFACTURER OR DISTRIBUTOR SHALL BE LIABLE FOR PERFORMANCE UNDER SUCH WARRANTIES. CUSTOMER SHALL NOT BE ENTITLED TO RECOVER FROM THE DEALERSHIP ANY CONSEQUENTIAL DAMAGES, DAMAGES TO PROPERTY, DAMAGES FOR LOSS OF USE, LOSS OF TIME, LOSS OF PROFIT OR INCOME, OR ANY OTHER INCIDENTAL DAMAGES.

By signing below, you acknowledge that you were notified of and authorized the Dealership to perform the services/repairs itemized in this Invoice and that you received (or had the opportunity to inspect) any replaced parts as requested by you. The vehicle is being returned to you in exchange for your payment of the Amount Due.

*** SHOP SUPPLY COSTS:**
A charge equal to 5% of the total cost of parts and labor will be added to the Repair Order for shop supplies used in connection with the repair.

ALL PARTS ARE NEW UNLESS OTHERWISE INDICATED.

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES *	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	

DATE CUSTOMER SIGNATURE AUTHORIZED DEALERSHIP REPRESENTATIVE SIGNATURE

PLEASE PAY THIS AMOUNT

12444

INVOICE

PAGE 2

MERLIN AUTO GROUP

2882 AMWILER RD
ATLANTA, GA 30360
(770) 457-2699
www.merlinautogroup.com

SERVICE ADVISOR: 117 MARK MCDANIEL

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG	
RED	07	FERRARI F430	ZFFEW58A670153265		18822/18822	T2444	
DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
14AUG21 DD			18:00 28AUG23		235.00	AE	24OCT23

R.O. OPENED	READY	OPTIONS:	SOLD-STK:P153265
11:44 28AUG23	09:31 24OCT23		

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

P0430-CATALYTIC CONVERTER EFFICIENCY BELOW THRESHOLD (LEFT BANK),
P0497-EVAPORATIVE EMISSION SYSTEM LOW PURGE FLOW (RIGHT BANK).
Tech 101: I removed both valves and tested for flow. There was no detectable flow issue with the valves. I marked and swapped the valves and will see what come back with a drive.

LUBE FUEL	CU					30.00	30.00
-----------	----	--	--	--	--	-------	-------

WARRANTY DISCLAIMER: ALL PARTS AND ACCESSORIES ARE SOLD AND ALL REPAIRS ARE PROVIDED BY THE DEALERSHIP AS-IS. THE DEALERSHIP HEREBY EXPRESSLY DISCLAIMS ALL WARRANTIES, EXPRESS AND IMPLIED, INCLUDING ANY IMPLIED WARRANTIES OF MERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE, AND NEITHER ASSUMES NOR AUTHORIZES ANY OTHER PERSON TO ASSUME FOR IT ANY LIABILITY IN CONNECTION WITH THE SALE OF PARTS OR PRODUCTS OR THE REPAIR. THE ONLY WARRANTIES ON PARTS AND ACCESSORIES OR REPAIRS ARE THOSE WHICH MAY BE OFFERED BY THE MANUFACTURER OR THE ORIGINAL PARTS DISTRIBUTOR AND ONLY SUCH MANUFACTURER OR DISTRIBUTOR SHALL BE LIABLE FOR PERFORMANCE UNDER SUCH WARRANTIES. CUSTOMER SHALL NOT BE ENTITLED TO RECOVER FROM THE DEALERSHIP ANY CONSEQUENTIAL DAMAGES, DAMAGES TO PROPERTY, DAMAGES FOR LOSS OF USE, LOSS OF TIME, LOSS OF PROFIT OR INCOME, OR ANY OTHER INCIDENTAL DAMAGES. By signing below, you acknowledge that you were notified of and authorized the Dealership to perform the services/repairs itemized in this Invoice and that you received (or had the opportunity to inspect) any replaced parts as requested by you. The vehicle is being returned to you in exchange for your payment of the Amount Due.	* SHOP SUPPLY COSTS: A charge equal to 5% of the total cost of parts and labor will be added to the Repair Order for shop supplies used in connection with the repair.	DESCRIPTION	TOTALS	
			LABOR AMOUNT	1662.50
			PARTS AMOUNT	309.42
			GAS, OIL, LUBE	30.00
			SUBLET AMOUNT	0.00
			MISC. CHARGES *	323.60
			TOTAL CHARGES	2325.52
			LESS INSURANCE	0.00
			SALES TAX	21.66
			PLEASE PAY THIS AMOUNT	2347.18

DATE _____ CUSTOMER SIGNATURE _____ AUTHORIZED DEALERSHIP REPRESENTATIVE SIGNATURE _____

MERLIN AUTO GROUP

2882 Amwiler Rd. - Atlanta, GA 30360
Ph: (770) 457-2699 | www.merlinautogroup.com

SERVICE DEPARTMENT HOURS
9:00 a.m. to 6:00 p.m.
Monday - Friday
Closed Saturday & Sunday

R/O Open Date	R/O Number				
06/18/25	6000604/1				
R/O Close Date	Status				
08/11/25	Final				
Mileage In	Mileage Out				
19814	19814				
Service Advisor / Tag #					
LAUREL BAKER/*W*					
Vehicle Identification Number					
ZFFEW58A670153265					
Delivery Date	In-Service Date				
Year	Make	Model	Body	Color	License Number
2007	FERRARI	F430		RED	
P153265					

DESCRIPTION OF SERVICE AND PARTS	AMOUNT
Cell: 814-323-4143 Email: RALPHFALKE@YAHOO.COM	
#1 - P3: PERFORM DETAILED MECHANICAL INSPECTION Caused by Phase 3 inspection Tech: MALCOLM BARNETT (102) Performed phase 3 inspection.	Internal
#2 - BATT: REPLACE 12V BATTERY Caused by Poor battery performance Tech: MALCOLM BARNETT (102) Installed MTZ34R :INTERSTATE BATTERY MTZ34R Replaced battery to correct condition.	Internal Internal
#3 - LOF: OIL AND FILTER CHANGE SERVICE, TOP OFF ALL NECESSARY FLUIDS, ADJUST TIRE PRESSURES OIL AND FILTER CHANGE SERVICE, TOP OFF ALL NECESSARY FLUIDS, ADJUST TIRE PRESSURES Caused by Annual service due Tech: MALCOLM BARNETT (102) Installed PEN5W40 :PENNZOIL 5W40 Installed 10261860 :COPPER WASHER M22 X 29 4602229 Installed 10265060 :COPPER WASHER 32X38 Installed 234742 :FERRARI OIL FILTER 430/CALIFOR Performed annual service including oil and filter	Internal Internal Internal Internal Internal

TERMS: STRICTLY CASH UNLESS ARRANGEMENTS ARE MADE. "I hereby authorize the repair work hereinafter to be done along with the necessary material and agree that you are not responsible for loss or damage to vehicle or articles left in the vehicle in case of fire, theft, or any other cause beyond your control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you or your employees permission to operate the vehicle herein described on streets, highways, or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto."

DISCLAIMER OF WARRANTIES. Any warranties on the products sold hereby are those made by the manufacturer. The seller hereby expressly disclaims all warranties either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and the seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said products. Any limitation contained herein does not apply where prohibited by law.

LABOR	
PARTS	
DEDUCTIBLE	
SUBLET	
SHOP SUPPLIES	
HAZARDOUS MATERIALS	
SALES TAX OR TAX I.D.	
SPECIAL ORDER DEPOSIT	
DISCOUNTS	
TOTAL DUE	

NO RETURN ON ELECTRICAL OR SAFETY ITEMS OR SPECIAL ORDERS.

X

MERLIN AUTO GROUP

2882 Amwiler Rd. - Atlanta, GA 30360
Ph: (770) 457-2699 | www.merlinautogroup.com

SERVICE DEPARTMENT HOURS
9:00 a.m. to 6:00 p.m.
Monday - Friday
Closed Saturday & Sunday

R/O Open Date	R/O Number				
06/18/25	6000604/2				
R/O Close Date	Status				
08/11/25	Final				
Mileage In	Mileage Out				
19814	19814				
Service Advisor / Tag #					
LAUREL BAKER/*W*					
Vehicle Identification Number					
ZFFEW58A670153265					
Delivery Date	In-Service Date				
Year	Make	Model	Body	Color	License Number
2007	FERRARI	F430		RED	
P153265					

DESCRIPTION OF SERVICE AND PARTS	AMOUNT
change, pollen filter and brake fluid flush.	

#4 - CABINAIR: REPLACE CABIN AIR FILTER REPLACE CABIN AIR FILTER Caused by Annual service due. Tech: MALCOLM BARNETT (102) Installed 65384300 :FERRARI CABIN POLLEN FILTER 36 Replaced pollen filter.	Internal Internal

#5 - BRKFSH: PERFORM BRAKE FLUID EXCHANGE PERFORM BRAKE FLUID EXCHANGE Caused by Annual service due Tech: MALCOLM BARNETT (102) Installed 601458 :SYNTHETIC DOT 3 AND 4 BRAKE FL Performed brake fluid flush.	Internal Internal

#6 - BRAKES: SERVICE BRAKES replace front brake pads Caused by Front brake pads worn. Tech: MALCOLM BARNETT (102) Installed 70001085 :FRT PAD SET Freight: UPS Replaced front brake pads	Internal Internal Internal

TERMS: STRICTLY CASH UNLESS ARRANGEMENTS ARE MADE. "I hereby authorize the repair work hereinafter to be done along with the necessary material and agree that you are not responsible for loss or damage to vehicle or articles left in the vehicle in case of fire, theft, or any other cause beyond your control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you or your employees permission to operate the vehicle herein described on streets, highways, or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto."

DISCLAIMER OF WARRANTIES. Any warranties on the products sold hereby are those made by the manufacturer. The seller hereby expressly disclaims all warranties either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and the seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said products. Any limitation contained herein does not apply where prohibited by law.

LABOR	
PARTS	
DEDUCTIBLE	
SUBLET	
SHOP SUPPLIES	
HAZARDOUS MATERIALS	
SALES TAX OR TAX I.D.	
SPECIAL ORDER DEPOSIT	
DISCOUNTS	
TOTAL DUE	

NO RETURN ON ELECTRICAL OR SAFETY ITEMS OR SPECIAL ORDERS.

X

MERLIN AUTO GROUP

2882 Amwiler Rd. - Atlanta, GA 30360
Ph: (770) 457-2699 | www.merlinautogroup.com

SERVICE DEPARTMENT HOURS
9:00 a.m. to 6:00 p.m.
Monday - Friday
Closed Saturday & Sunday

R/O Open Date	R/O Number				
06/18/25	6000604/3				
R/O Close Date	Status				
08/11/25	Final				
Mileage In	Mileage Out				
19814	19814				
Service Advisor / Tag #					
LAUREL BAKER/*W*					
Vehicle Identification Number					
ZFFEW58A670153265					
Delivery Date	In-Service Date				
Year	Make	Model	Body	Color	License Number
2007	FERRARI	F430		RED	

Year	Make	Model	Body	Color	License Number
2007	FERRARI	F430		RED	

DESCRIPTION OF SERVICE AND PARTS	AMOUNT
#7 - COOLING: CHECK AND ADVISE REPLACE COOLANT TANK CAP Caused by Coolant pressure cap leaking. Installed 145030 :FERRARI EXPANSION TANK CAP POS Replaced coolant pressure cap to correct condition. Complete.	Internal
#8 - DIAG: DIAGNOSE DIAG LIGHT SOCKET Caused by Lighter socket broken and unplugged. Tech: MALCOLM BARNETT (102) Installed 226941 :FERRARI CIG LIGHTER RECIEVER Replaced lighter socket to correct condition. Verified correct operation of new part.	Internal Internal
#9 - DIAG: DIAGNOSE Diagnose headlight washer jets not working Caused by Hose fitting for washer headlamp pump is broken. Tech: MALCOLM BARNETT (102) Installed 68141200 :HEADLAMP WSHR HOSE Freight: DHL	Internal Internal Internal

TERMS: STRICTLY CASH UNLESS ARRANGEMENTS ARE MADE. "I hereby authorize the repair work hereinafter to be done along with the necessary material and agree that you are not responsible for loss or damage to vehicle or articles left in the vehicle in case of fire, theft, or any other cause beyond your control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you or your employees permission to operate the vehicle herein described on streets, highways, or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto."

DISCLAIMER OF WARRANTIES. Any warranties on the products sold hereby are those made by the manufacturer. The seller hereby expressly disclaims all warranties either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and the seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said products. Any limitation contained herein does not apply where prohibited by law.

LABOR	.00
PARTS	.00
DEDUCTIBLE	.00
SUBLET	.00
SHOP SUPPLIES	.00
HAZARDOUS MATERIALS	.00
SALES TAX OR TAX I.D.	.00
SPECIAL ORDER DEPOSIT	.00
DISCOUNTS	.00
TOTAL DUE	.00

NO RETURN ON ELECTRICAL OR SAFETY ITEMS OR SPECIAL ORDERS.

X



FULL MECHANICAL INSPECTION

REPAIR ORDER #:	0604	DATE:	06-20-2025
YEAR/MAKE/MODEL:	2007 Ferrari F430	MILEAGE:	19,814
CHASSIS:	153265	TECHNICIAN #:	102

STATIONARY REVIEW

Convertible top (if applicable)	N/A	Sunroof (if applicable)	N/A
HVAC function / performance	Operational	Windshield defrosters	Operational
Outside mirrors adjustments and functions	Operational	Rear view mirror adjustments and functions	Operational
Power windows (all windows)	Operational	Door locking functions (all doors)	Operational
Key and/or remote control functions	Operational	Glove box functions	Operational
Steering column adjustments and functions	Operational	Horn function	Operational
Stalk control functions	Operational	Seat belts	Operational
Seat functions (all seats)	Operational	Heated / ventilated seats (if applicable)	N/A
Radio functions	Operational	Antenna	Operational
AUX power ports (e.g. cigar lighter)	Needs diagnostic	Parking brake function	Operational
Gearshift functions	Operational	Dashboard / cluster functions	Operational
Hood (bonnet) release	Operational	Trunk release	Operational
Fuel door release	Operational	Gas shocks (hood/trunk/engine)	Operational
Windshield washer jets	Operational	Headlight washer jets	Needs diagnostic
Comments	<p>Lighter socket has no power.</p> <p>Headlight washers not working. Can hear the pump running but no spray.</p>		

LIGHTS

Headlights and assembly	OK	High beam flasher	OK
Turn signals	OK	Rear taillights and assembly	OK
Brake lights	OK	3rd brake light (if applicable)	OK
Reverse lights	OK	License plate lights	OK
Fog lights	N/A	Hazard lights	OK
Side / directional lights	OK	Parking lights	OK
Visor lights	N/A	Dome light(s)	OK
Glove box light	OK	Dashboard / courtesy lights	OK
Comments	All lights working properly at this time.		

CHECK BATTERY			
Battery health	OK	Battery cables / connections	OK
UNDERCARRIAGE			
Suspension components	OK	Front control arm bushings	OK
Steering rack	OK	Axle mountings / boots	OK
Engine mounts	OK	Transmission mounts	OK
Exhaust manifold	OK	Catalytic converters	OK
Muffler(s)	OK	Exhaust pipes	OK
Lifting blocks	Good condition	Subframe	Good condition
Comments	No notable concerns during inspection of undercarriage.		
FLUIDS / LEAKS			
Gasket condition	No leak detected	Engine oil	No leak detected
Transmission oil	No leak detected	Coolant	No leak detected
Differential	No leak detected	Half shafts	No leak detected
Fuel	No leak detected	Brakes	No leak detected
Power steering	No leak detected	Hydraulic	No leak detected
A/C	No leak detected	Shocks / struts	No leak detected
Comments	No notable leaks at this time.		
CHECK TIRES AND TREAD DEPTH			
Location	LEFT	RIGHT	Wear Pattern/Damage observed?
FRONT TIRES	8/32 or greater	8/32 or greater	<input type="checkbox"/> LF <input type="checkbox"/> RF <input type="checkbox"/> RR <input type="checkbox"/> LR <input checked="" type="checkbox"/> N/A
REAR TIRES	8/32 or greater	8/32 or greater	
Are tires older than 5 years?	No	Specify if alignment, balance or rotation needed	N/A
CHECK BRAKES			
FRONT BRAKES	Close	REAR BRAKES	OK
Tires/Brakes Comments	Front inner brake pads are at 4 mm		

ENGINE / TRANSMISSION			
Cold / hot starting	OK	Idle	OK
Belts and belt tensioners	OK	Coolant hoses	OK
Power steering hoses (if applicable)	OK	Fuel lines	OK
A/C lines	OK	Alternator	OK
Other electrical cables / wiring / fuse boxes	OK	List Diagnostic Trouble Codes	No active codes stored.
Clutch wear %	53% wear		
Engine compression / leak down test results (if applicable)	N/A		
Comments	No notable concerns at this time. Clutch wear is at 53%.		
ROAD TEST / DYNAMIC REVIEW			
Stability	OK	Acceleration	OK
Braking	OK	ABS (if applicable)	OK
Transmission / clutch	OK	Steering alignment	OK
Vibration	OK	Cruise control (if applicable)	N/A
Gauges	OK	Wind noise	OK
Road noise	OK	Rattles / squeaks	OK
Comments	No notable issues during test drive.		
MAINTENANCE RECOMMENDATIONS			
<input checked="" type="checkbox"/> Engine Oil <input checked="" type="checkbox"/> Brake Fluid <input type="checkbox"/> Coolant <input type="checkbox"/> Power Steering Fluid <input checked="" type="checkbox"/> Cabin Air Filter(s) <input type="checkbox"/> Engine Air Filter(s) <input type="checkbox"/> Wiper Blades <input type="checkbox"/> Gearbox Fluid <input type="checkbox"/> Timing Belt(s) <input type="checkbox"/> Accessory Belt(s) <input type="checkbox"/> Spark Plugs <input type="checkbox"/> Cam Seals <input type="checkbox"/> Valve Cover Gaskets <input type="checkbox"/> N/A			Service reminder presence? NA
TECHNICIAN SUMMARY			
Vehicle seems to be maintained fairly well. Would recommend an annual service and front brake pads. Would also recommend a new coolant reservoir, pressure cap.			


TECHNICIAN PHOTOS





Tire dates good




Tire dates good.

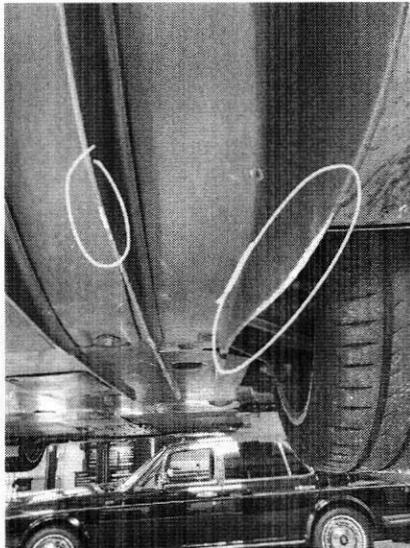

Under tray has scuffs at right and left fins

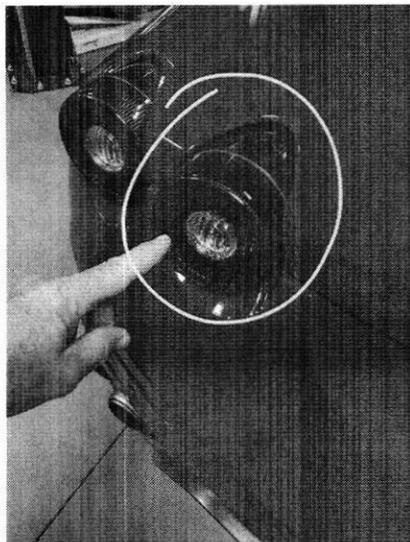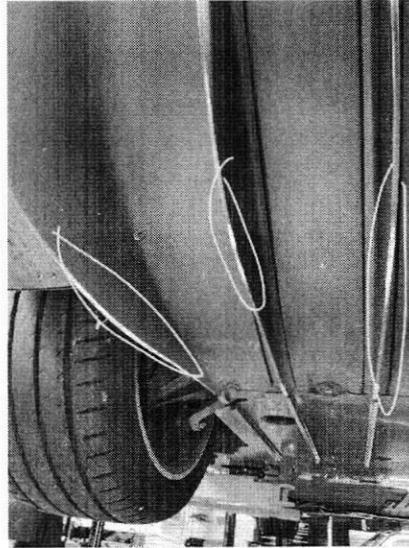

Left inner tail lamp assembly loose. Possibly

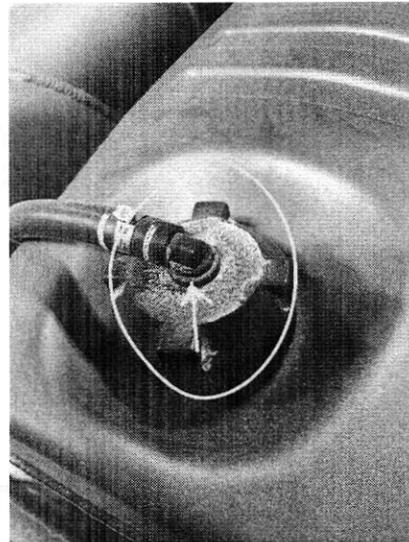

Coolant pressure cap leaking at overflow hose